

Voice Software (Core wi03.18)

Patch Description: The purpose of this patch is to apply a new core image (wi03.18) to a BCM 3.0/3.0.1 system.

SR/CRs fixed (versus BCM 3.0 GA):

CorePatch wi03.18 - Loadbuild Date: April 14, 2004 [[Official Release Note](#)]

- Q00813441-01 - core reset at Agency site

CorePatch wi03.17 - Loadbuild Date: November 19, 2003 [[Official Release Note](#)]

- Q00633770 - Add missing entries in the DMS250 State Transition Table
- Q00633770 - Fix the tx/rx of TCAP messages in the DMS100 protocol table
- Q00633770 - Increase the MCDN TCAP Fac IE from 64 to 128 for DMS to M1 MWI
- Q00759960 - Port bus error fx for Q00759960
- Q00789981 - Release reroute handshake missed
- Q00780760 - Correct the MCDN-IP Connected Number Univ IE value
- Q00756256 - Fix data corruption causing PRI call drops

CorePatch wi03.16 - Loadbuild Date: October 29, 2003 [[Official Release Note](#)]

- Q00724598 - Agents telset shows supervisors DN being silent monitored.
- Q00712860 - Move Line and CAP HG key [Also Q00750230 (P3/PV), Q00749586 (P3/PV), Q00749937 (P3/PV)]
- Q00746014 - Prevent core reset due to NI S-loop SPID rejection [Also Q00627111 (P4/DEV)]
- Q00707308-01 - DPNSS link Unisys - OLI Field Being Ignored
- Q00747072 - Lp grd trks fails to busy.
- Q00715043 - Place call on HOLD ... call gets dropped by porting of mitalp.36 from MAIN. Fix for Q00557398.
- Q00772362 - Add MCDN display (no oct4) and Connect Number (present restrict) - changes in MCDN protocol table
- Q00674189 - Fix the PRI NI2 redirecting number - changes in NI2 protocol table

CorePatch wi03.15 - Loadbuild Date: September 5, 2003 [[Official Release Note](#)]

- Q00728715 & Q00708044 - Add to Progress Indicator: LOC and PD missing from spec
- Q00606156 - port "Add file to units file that fixes ROI for Australia" from
- Q00731708 - Prevent endless loop of HoldRtn calling StartPage(PG_GETZONE)

- Q00656823 - Port chunky.89 to BCM30 stream: no CLID with UK GATC trunk
- Q00712233 - Fix Dai writing of set/room assignment nvram chksum

CorePatch wi03.14 - Loadbuild Date: August 26, 2003 [[Official Release Note](#)]

- Q00710296 - KIM/CAP DSS buttons with set index > 255 [Also Q00712850 (P3/AT)]
- Q00683085 - Blind transfer to DECT h/s bounces back right away.
- Q00700853 - Permit other L1 protocol in bearer capability for non speech calls
- Q00708252 - BCM(3.0/3.01)OWT When Autodial HG with HeadSet on M/N series phones
- Q00705776 - If MCDN trunk has started to release then reject TAT request
- Q00662844 - Correct response to incorrect IE in DISCONNECT and RELEASE
- Q00686312 - Allow the MCDN Connected Number to be up to 24 digits long
- Q00658553 - Slight echo heard on 3 calls over a 9 minute period

CorePatch wi03.13 - Loadbuild Date: July 8, 2003 [[Official Release Note](#)]

- Q00693063 - Verify valid TN before connecting a DTMF receiver

CorePatch wi03.12 - Loadbuild Date: June 30, 2003 [[Official Release Note](#)]

- Q00660936 - Incoming calls from Embark switch fails when routed thru AA and
- Q00676574 - Remove Hong Kong regulatory update for T1 alarm processing

CorePatch wi03.11 - Loadbuild Date: June 9, 2003 [[Official Release Note](#)]

- Q00665263 - Accept CR of length 2 for MCDN
- Q00660936 - To fix AA related issue for Embark-DPNSS protocol
- Q00659170 - Make MCDN MWI follow the LCR service mode - Civista
- Q00681283 - Send Alert on CFWD tandem from ISDN to T1 trunk
- Q00664319 - Eliminate the log 693 after a tandem TAT call (part of CR)
- Q00668025 - Make sure the new node dn_appr set correctly
- Q00660411 - Fix TRO for trunk-trunk tandem call

CorePatch wi03.10 - Loadbuild Date: May 15, 2003 [[Official Release Note](#)]

- Q00666785 - Update France external ring cadence to correct timing
- Q00668025 - Make sure the old my_ref cleared after TAT to physical line appr
- Q00666785 - Update France external ring cadence to correct timing
- Q00607571 - Allow loop provisioning to proceed even DTI is already provisioned

- FN0012 - Fixing DTI Boot load to allow power up on TM
- Q00648497 - Improve performance of D8 tx/rx Interrupt service routine
- Q00603719 - Update prifw control files to use new paths to hp libraries
- Q00548170 - Port fix for DTMF buffering problem to BCM 3.0 [also Q00653371, Q00658552]
- Q00653371 - Back out part of dsaint.1024 (port of narayanan.21) for now
- Q00623478 - To fix CC SM getting "observe failed" [also Q00657782]
- Q00660503 - Headset lamp stays lit when monitored agent release

CorePatch wi03.08 - Loadbuild Date: April 15, 2003 [[Official Release Note](#)]

- Q00638035 - Enhancement: Call Centre DNIS routing not working for ETSI Euro
- Q00642709 - Correct LCR for tandem calls (with no DC_COMPLETE)

CorePatch wi03.07 - Loadbuild Date: March 31, 2003 [[Official Release Note](#)]

- Q00634506 - APAC request to change Australia ringback to be same as UK

CorePatch wi03.06 - Loadbuild Date: March 20, 2003 [[Official Release Note](#)]

- Q00556522 - Add support for ECF cause fallback to Normal route
- Q00614558 - Shut down PRI trunk emulators upon DTI reset
- Q00620620 - Disallow VoIP fallback after the call has been answered
- Q00631549 - IP Sets Monitoring Unsupervised Calls

CorePatch wi03.01 - Loadbuild Date: January 11, 2003 [[Official Release Note](#)]

- Q00555074 - Correct the Connected Number Subaddress on MCDN private calls
- Q00554575 - Add support for second NMS MWI format with MCDN RCAP=XMWI
- Q00565042 - Fix stim key xlation for ip20xx sets - missing 11 & 12
- Q00570973 - Port 3.5 fix for error pop-up on adding ISDN/DECT DN
- Q00561569 - Fix up onS_TRANNSFER prompt
- Q00541242 - Low volume on analog ports/BCM - second fix [also Q00530646]
- Q00580220 - Prepend "00" for International calls in the UK and Germany
- Q00586239 - Add MCDN protocol support for CNN with no digits
- Q00549085 - Fix auto hold cancel by F#74
- Q00593319 - Prevent DM log 115 and initialize DM NVRAM on Bus 7
- Q00602665 - Fix the PRI NI2 SERVICE message Change Status IE format. [also Q00602631]
- Q00111329 - Resubmit fix - To resolve the expiration of T310 issue. [maps to SR10394937]
- Q00596046 - Fix Target Line Aux Ringing setting.

- Q00594517 - Allow MCDN PRI tandem with dial tone for auth codes.
- Q00602912 - Clear the IC key call + IT data after TAT to Line Appr key.
- Q00592662 - Make sure we allocate enough RAM for IP sets
- Q00553460 - Using i2002 headset for SM as supervisor call is heard through speaker.