

## BCM360.278-UM

Software Update Name: Unified Manager 3.6 Patch.

Applicable H/W Platforms: BCM1000, BCM200, BCM400

Applicable S/W Platforms: BCM 3.6

Category: GEN

Installation Recommendations: Not Urgent.

Component & Version: Unified Manager 3.6 Build 2.2c

Dependencies: Required patches - Cumulative Patch CP3  
BCM\_360.249\_CP3

Product Dependencies: None

Size: 1.14MB

System Impact: Time to apply is 20 minutes, two reboots are required

Does patch application force reboot: Yes

Other: None.

Limitations: None

Patch Removable: No

The following issues are addressed:

1. The BCM can be used as a DHCP server for a CSE1000. We can change option 128 in the Global settings in the DHCP page of Unified Manager to use port 4100 instead of 7000. This works, but when you reboot the BCM, the option changes back to port 7000.

CR Q01106118

2. This fix displays a message for the user to reboot the BCM whenever BCM DHCP config is changed from server to relay agent or vice versa. This reboot message is needed due to the fix for the CR Q00979221, which had changes in mspQoS to do some special processing when BCM is relay agent.

CR Q01153688

This patch includes the content of the following superseded patches:

- o BCM 360.007 UM.39.1001
- o BCM\_360.082\_UM.39.1003
- o BCM\_350.011\_UM.39.1002
- o BCM\_360.184\_UM.39.1006
- o BCM\_360.239\_UM3.39.001