

Core Patch (wi05.26)

Patch Description: The purpose of this patch is to apply a new core image (wi05.26) to the BCM 2.5 Feature Pack 1 & Feature Pack 1 Maintenance Release system.

SR's Resolved:

- **CorePatch (wi05.26) - LoadBuild Date: November 28, 2002 [Release note]**
 - Q00541242: Low volume on analog ports/BCM - second fix
 - Q00530646: Low volume on analog ports/BCM - second fix
 - Q00559180: Add comment re: B2RelocMax error
- **CorePatch (wi05.25) - Loadbuild Date: [Release note]**
 - Q00515183: Fix core reset due to timer error (log 626/630)
 - Q00518693: Don't display area core format in non-NorthAm markets
 - Q00508154: Update NorthAm lossplan to allow higher vol on analog trunk
 - Q00534000: Protect against a core reset with no DTMF receivers
 - Q00502462: Add support for second ICLID received on ISDN trunks [also Q00531794]
- **CorePatch (wi05.23) - LoadBuild Date: September 26, 2002 [Release note]**
 - Changes have been made to the Loss-Plan tables to fix issues with low volume on analog trunks.
- **CorePatch (wi05.19) - LoadBuild Date: September 18, 2002 [Release note]**
 - Q00477905: Channels remain open after TAT
 -
 - Q00477259: TRO and TAT not working on BCM 3.0 Alpha 5.0
 -
 - Q00509459: BT- Distinctive ring CLID display is slow to update
 -
 - Q00473640: No Voice Path
 - Fix problem with loss of voice path on PRI trunks. [also Q00497846]
- **CorePatch (wi05.16) - LoadBuild Date: July 23, 2002 [Release note]**
 - Q00386548: Hunt group rings busy
 - Correct problem with HG01 getting "HG busy"
 - Q00431539: CSR: BT-BCM- One way transmission on Call Centre Agents
 - Stop X_TONE_OFF request causing loss of voice path. [also Q00478208]
 - Q00461396: Call Forwarded into Hunt Group doesn't ring all members
 - For empty pool list, generate a KEY_NULL_ID list instead.
 - Q00474031: Using IP trunks and DND makes call Dissappear
 - Change DoAllocateIpTdm to report PATH_OK if state=PATH_ALLOCATED

- Q00285044: Arlanger-Chattanooga, TN; VoIP Tandem calls are delaying and not setting up call
 - This fix solves 2sec delay problem for voip-dti gateway
- Q00436709: User Speed dials overwriting speed dials of another DN - tower health
 - Correct coldstart default range for User Speed Dial
- Q00436709: User Speed dials overwriting speed dials of another DN - tower health
 - Add upgrade code to fix user speed dial overlap problem
- Q00461486: Case 020606-74799/BCM FP-1/When using the F812 to select a number to call, can't
 - Allow non-IPwireless sets to dial log digit "9"
- **CorePatch (WI05.14) - Loadbuild Date: June 19, 2002 [[Release note](#)]**
 - Q00431878: System reset at Texas Association of Business
 - Release semaphore if DspStimQ write fails
 - Q00336658: Unable to Retrieve a Parked Call
 - Fix for TAT related problems when Appearances are involved.
 - Q00231914: BT- BCM- Hunt Group problem on DECT
 - Alter DECT B-Setup message to use multiple B-channels
 - Q00217145: T1 tandeming to another BCM causes KSU resets
 - Eliminate logs 136 & 193 in tandem T1-E&M to MCDN-IP trunk call
 - Q00461779: F819 not working when Using BCM2.5 MR1.1 via Radvisoin gatekeeper
 - Make sure that IP loops get the correct loop map type
 - Q00386548: Hunt group rings busy
 - Correct problem with HG01 getting "HG busy"
- **CorePatch (WI05.10) - Loadbuild Date: May 6, 2002 [[Release note](#)]**
 - Q00462556: Invitrogen/ BCM 2.5 FP 1/ Issue's with tranfering calls; "not in service" / Case
 -
 - Q00318054: 3rd pri cause call center reporting problems and drop calls - Fix a hole in the clock server logic to keep server going.
 - Fix a hole in the clock server logic to keep server going.
 - Q00412270: System Reset at MOP BCM (switching on IP keepalive feature) - Only send stim to DNs when they are up when keepalive changed.
 - Only send stim to DNs when they are up when keepalive changed.
 - Q00281730: Need to add support for MCDN MWI from MIK key - Add support for MCDN MIK/MCK lamp indications
 - Add support for MCDN MIK/MCK lamp indications
 - Q00389174: Some Media Gateways are not being used by NM/MPS - Increase ACK_CLOSE_GW timeout.
 - Increase ACK_CLOSE_GW timeout.

- Q00321473: Case 020328-94831/BCM 2.5 unable to transfer calls to TDM sets - Release IT server header if all IT information elements gone.
 - Release IT server header if all IT information elements gone. [also Q00416661, Q00249217]
- Q00336658: Unable to Retrieve a Parked Call - Fix for Analog appearances when TAT invoked.
 - Fix for Analog appearances when TAT invoked.
- Q00425124: DASS incoming call when Tandem thro BCM MCDN over IP to second BCM no CLID - Allow the tandem of Calling Number from a DASS2/analog trunk
 - Allow the tandem of Calling Number from a DASS2/analog trunk
- Q00245499: Route Optimization issue with BTEX Unisys - Route Optimization issue with BTEX Unisys
 - Route Optimization issue with BTEX Unisys
- Q00426727: MSC Core cold started May 3 itas system - Add watchdog reset to prevent coldstart after warmstart
 - Add watchdog reset to prevent coldstart after warmstart

CORE Version Codes:

- **CorePatch (WI05.26) [Release note]**
 - 30BIF26 - EE-CT2P-2.5 (T1)
 - 30AyF26 - EE-ETQ-2.5 (E1-CALA)
 - 30AzF26 - EE-ETQ-2.5 (E1-Europe)
 - 30BoF26 - EE-ETQ-2.5 (E1-Global)
 - 30BQF26 - EE-ETQ-2.5 (T1)
- **CorePatch (WI05.23) [Release note]**
 - 30BIF23 - EE-CT2P-2.5 (T1)
 - 30AyF23 - EE-ETQ-2.5 (E1-CALA)
 - 30AzF23 - EE-ETQ-2.5 (E1-Europe)
 - 30BoF23 - EE-ETQ-2.5 (E1-Global)
 - 30BQF23 - EE-ETQ-2.5 (T1)
- **CorePatch (WI05.19) [Release note]**
 - 9ABIF19 - EE-CT2P-2.5 (T1)
 - 9AAyF19 - EE-ETQ-2.5 (E1-CALA)
 - 9AAzF19 - EE-ETQ-2.5 (E1-Europe)
 - 9ABoF19 - EE-ETQ-2.5 (E1-Global)
 - 9ABQF19 - EE-ETQ-2.5 (T1)
- **CorePatch (WI05.16) [Release note]**
 - 30BIF16 - EE-CT2P-2.5 (T1)
 - 30AyF16 - EE-ETQ-2.5 (E1-CALA)
 - 30AzF16 - EE-ETQ-2.5 (E1-Europe)
 - 30BoF16 - EE-ETQ-2.5 (E1-Global)
 - 30BQF16 - EE-ETQ-2.5 (T1)
- **CorePatch (WI05.14) [Release note]**
 - 30BIF14 - EE-CT2P-2.5 (T1)

- 30AyF14 - EE-ETQ-2.5 (E1-CALA)
- 30AzF14 - EE-ETQ-2.5 (E1-Europe)
- 30BoF14 - EE-ETQ-2.5 (E1-Global)
- 30BQF14 - EE-ETQ-2.5 (T1)
- **CorePatch (WI05.10) [[Release note](#)]**
 - 30BIF10 - EE-CT2P-2.5 (T1)
 - 30AyF10 - EE-ETQ-2.5 (E1-CALA)
 - 30AzF10 - EE-ETQ-2.5 (E1-Europe)
 - 30BoF10 - EE-ETQ-2.5 (E1-Global)
 - 30BQF10 - EE-ETQ-2.5 (T1)
- **BCM 2.5 FP1 Upgrade [[Release note](#)]**
 - 9HBIF06 - EE-CT2P-2.5 (T1)
 - 9HAyF06 - EE-ETQ-2.5 (E1-CALA)
 - 9HAzF06 - EE-ETQ-2.5 (E1-Europe)
 - 9HBoF06 - EE-ETQ-2.5 (E1-Global)
 - 9HBQF06 - EE-ETQ-2.5 (T1)
- **BCM 2.5 FP1 GA [[Release note](#)]**
 - 30BIF06 - EE-CT2P-2.5 (T1)
 - 30AyF06 - EE-ETQ-2.5 (E1-CALA)
 - 30AzF06 - EE-ETQ-2.5 (E1-Europe)
 - 30BoF06 - EE-ETQ-2.5 (E1-Global)
 - 30BQF06 - EE-ETQ-2.5 (T1)

Software Components Changed:

Etiquette, CT2Plus, E1, E1 Global and E1 CALA core image files.

BCM Release and Affected Profiles:

- BCM 2.5 Feature Pack 1
- BCM 2.5 Feature Pack 1 Maintenance Release

Prerequisite Patch(es): None

Previous Patch(es) Included: None